

# PORSCHE 2006-10 Cayman

## PRECAUTIONS


**Warning:** When performing service on or near the SIR components or the SIR wiring, the SIR system must be disabled. Failure to observe the correct procedure could cause deployment of the SIR components, personal injury, or unrequired SIR system repairs.

**Warning:** Batteries generate hydrogen gas, which is extremely flammable and may explode violently if ignited by a spark or a flame. Battery acid is extremely corrosive and causes severe personal injury if the acid comes into contact with skin, and blindness if the acid comes into contact with eyes. In order to avoid severe personal injury, use extreme caution when servicing the battery or battery-related components.

## BATTERY

### Removal

1. Open turn lock caps (A) of battery cover and take off plastic lid, **Fig. 1**.
2. Disconnect battery ground cable from battery, **Fig. 2**.

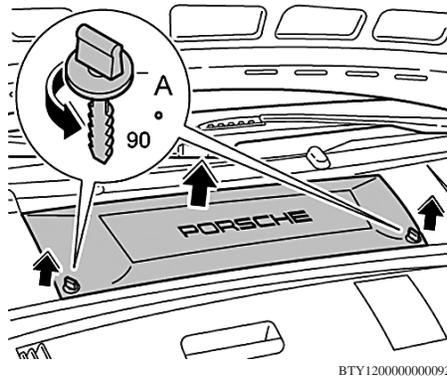


**Fig. 1 Battery access cover**

3. Disconnect battery positive cable from battery.
4. Pull vent hose (C) away from battery, **Fig. 2**.
5. Remove fastening screw for battery mount (B), and remove battery mount, **Fig. 2**.
6. Remove battery.

### Installation

1. Install battery.

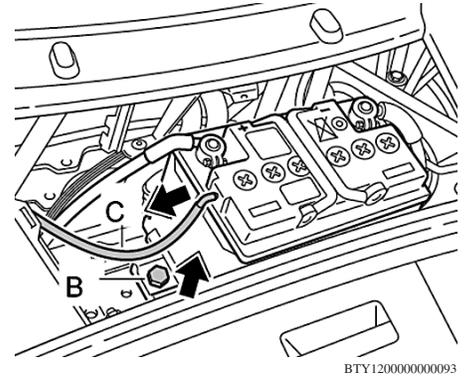

**Fig. 2 Battery removal**

2. Install battery mount and tighten fastening screw. **Torque** screw to 17 ft. lbs.
3. Insert vent hose for battery.
4. Connect battery positive cable to battery. **Torque** cable bolt to 44 inch lbs.
5. Connect battery ground cable to battery. **Torque** cable bolt to 44 inch lbs.
6. Position battery cover and secure using two twist locks.

The material herein may not be used without the prior express written permission of the copyright holder, including, but not limited to reproduction or transmission in any form by any means such as electronic, mechanical, photocopying, recording or otherwise; nor may it be stored on any retrieval system of any nature.

"The data reported herein has been compiled from authoritative sources. While every effort is made by the analysts to attain accuracy, manufacturing changes as well as typographical errors and omissions may occur on occasion. The publisher cannot be responsible nor does it assume any responsibility whatsoever for such omissions, errors or changes."

**MOTOR INFORMATION SYSTEMS**  
**MOTOR is a trademark of Hearst Business Media**  
A Unit of Hearst Corporation  
1301 W. Long Lake, Suite 300  
Troy, MI 48098

Copyright © 2012 Hearst Business Media. All rights reserved.